# Crabtree

DL21818/A - (SF)


## Wiring Accessories


## Fitting and wiring Instructions –

- Before commencing work switch off the power supply by removing the fuse in the fuse box, or should isolate
  at main switch as neutral is a live conductor.
- 2). If unit is to be used as a replacement for an existing product, remove existing unit from its location and disconnect the wiring.
- 3). Connect the wires as shown in appropriate wiring diagrams below and overleaf. Use green/yellow sleeving on earth conductors not insulated. Ensure terminals are properly tightened and no bare wire is visible. Push back unit into mounting box making sure conductors are not trapped.
- 4). Screw the unit to the mounting box using screws provided. Do not over tighten fixing screws.
- These products must be installed in accordance with the latest Building and IEE wiring regulations. If in any doubt, please contact a qualified electrician

## **1 GANG 1 WAY 10AX SWITCH**


## 1 GANG 2 WAY 10AX SWITCH

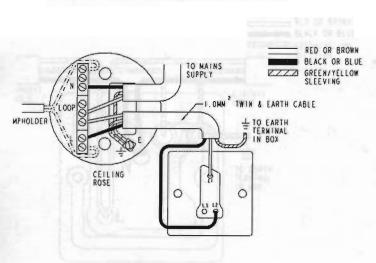


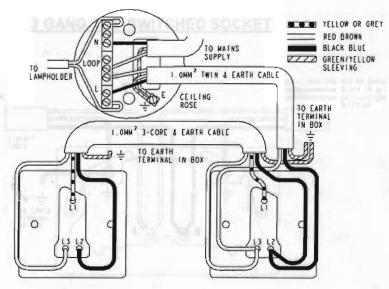

## 2 GANG 2 WAY 10AX SWITCH


## 3 GANG 2 WAY 10AX SWITCH

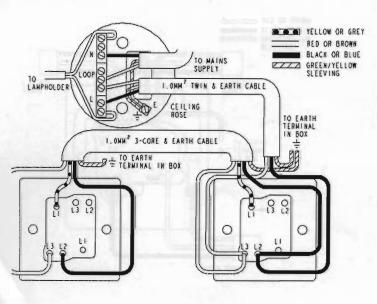


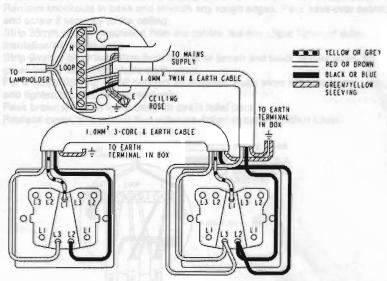

#### **6A FAN ISOLATOR WITHOUT TIMER**


#### **6A FAN ISOLATOR WITH TIMER**

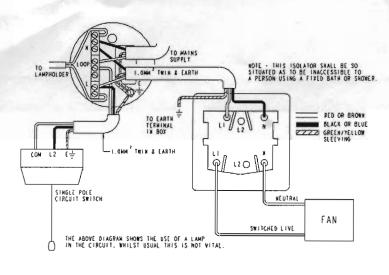


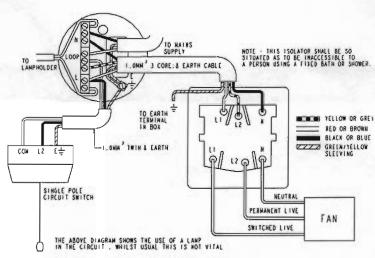

## **1 GANG 13A SWITCHED SOCKET**


## **2 GANG 13A SWITCHED SOCKET**

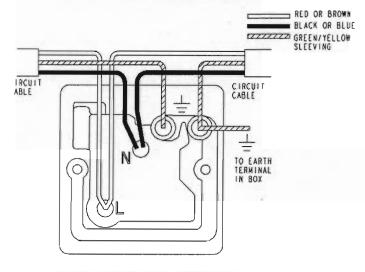

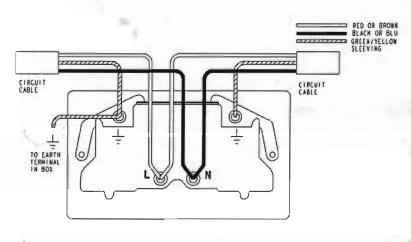

#### 13A SWITCHED CONNECTION UNIT

#### **PENDANT SETS**

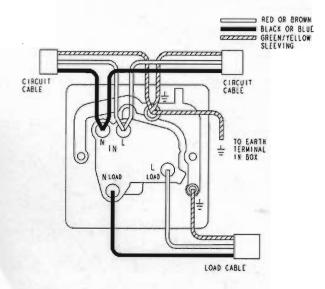

Unscrew cover and ease brown and blue wires from beneath strain relief bars. Remove knockouts in base and smooth any rough edges. Pass base over cables and screw it securely to the ceiling.


Strip 35mm of outer insulation from the cables, leaving about 12mm of outer insulation within the base.

Strip 9mm of inner insulation from the red or brown and black or blue wires. Fit green/yellow sleeving to bare earth wires.

For a typical lighting circuit connect as diagram. Push wires fully into terminals and tighten terminal screws securely.

Pass brown and blue wires beneath strain relief bars.

Replace cover, and ensure that outer insulation of cable is within cover.

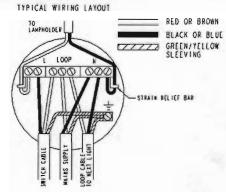

ELECTRIUM SALES LIMITED, Lichfield Road, Brownhills, West Midlands, England, WS8 6JZ. Telephone: 01543 455033. Facsimile: 01543 455011